

## **AXIS Q35 Dome Camera Series**

**AXIS Q3546-LVE Dome Camera**

**AXIS Q3548-LVE Dome Camera**

**AXIS Q3556-LVE Dome Camera**

**AXIS Q3558-LVE Dome Camera**

**Repainting instructions**

## Impact on warranty

This product is approved for repaint by Axis, provided that you follow the instructions in this document and at [axis.com/warranty-implication-when-repainting](https://axis.com/warranty-implication-when-repainting).

## Risks with repainting

There are several risks when disassembling or assembling an Axis product. Training of operators and the use of correct tools mediates some of the problems but they can never be fully avoided. Some of the risks include:

**ESD Damage** – Always handle the product in an ESD safe environment. Even if precautions are taken there is always a risk of ESD damage. The damage can remain undetected and cause problems during the lifetime of the equipment.

**Dust contamination** – Opening a camera may expose the lens and sensor to dust or paint. Dust will affect the optical performance. Lenses need to be disassembled in a dust-free environment, preferably a cleanroom.

**Paint overspray** – Masking the different components of the equipment is critical. Failure to mask sensitive areas can cause problems when assembling the equipment. Areas not painted at the factory or which have a different surface treatment than the parts to be painted (threads, ground and electrical contact surfaces) must also be masked to ensure function.

## Repaint the product

### Preparations

- If applicable, disassemble the device according to the instructions in this document.
- Clean all parts that will be repainted thoroughly to remove grease, dust, or oil.
- To ensure reassembly and functionality of the product, mask any openings (for example for screws, LED indicators, or microphones) before you paint.
- To avoid unwanted reflections, mask the inside of the weathershield before you paint.

### Pretreatment of parts

Depending on the part material and type of coating applied at the factory, pretreatment might be necessary for the new coating to adhere well. Before you apply a new coating, we recommend the following pretreatment:

1. If necessary, roughen up the surface with a light sandpaper or similar to increase adhesion. Alternatively, remove the original coating down to the base material.
2. Clean the parts properly to remove oil, grease, and dust.
3. If necessary, apply a primer layer suitable for the specific material, to increase adhesion to the parts. For metal parts on outdoor products, we recommend a primer to improve corrosion resistance.


We recommend pretreatment of parts that are:

- powder-coated
- wet-painted
- anodised
- chromated
- stainless steel
- other metal
- plastic


The material used in this product is aluminum.

The weathershield is made of plastic (PC/ASA).

## Disassembly

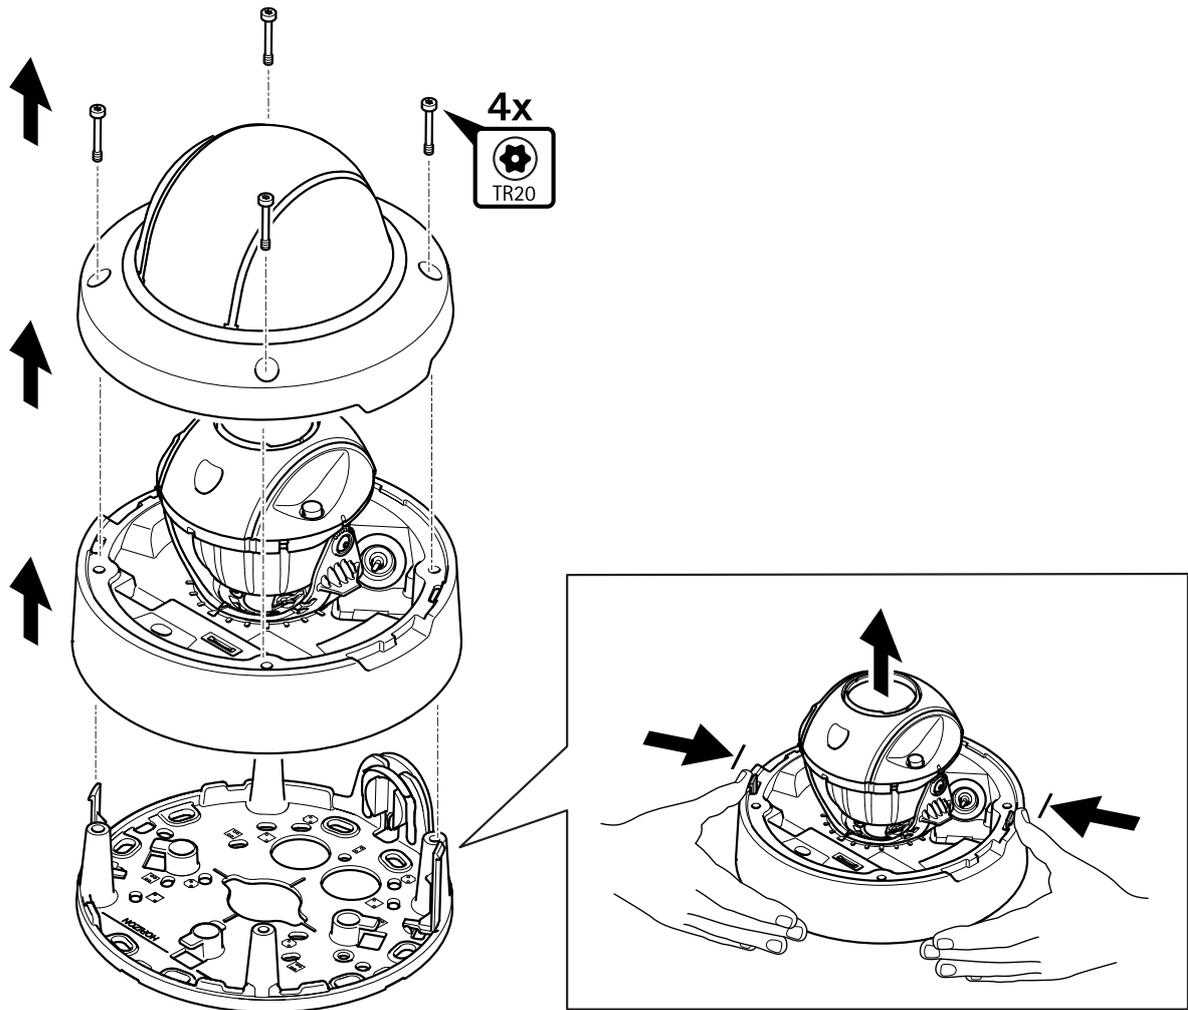


1. Remove the four screws, cover top, holder dome, gasket dome and dome. To remove the mounting bracket, press the plastic clips.

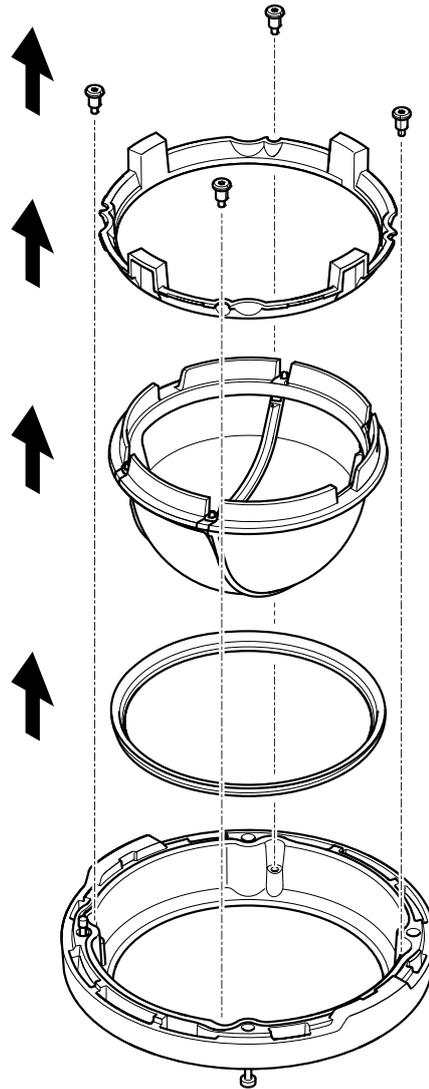


2. Remove the four screws, holder dome, dome and gasket dome.

## Repainting

1. Make sure all necessary preparations have been made. See *Preparations*, on page 3

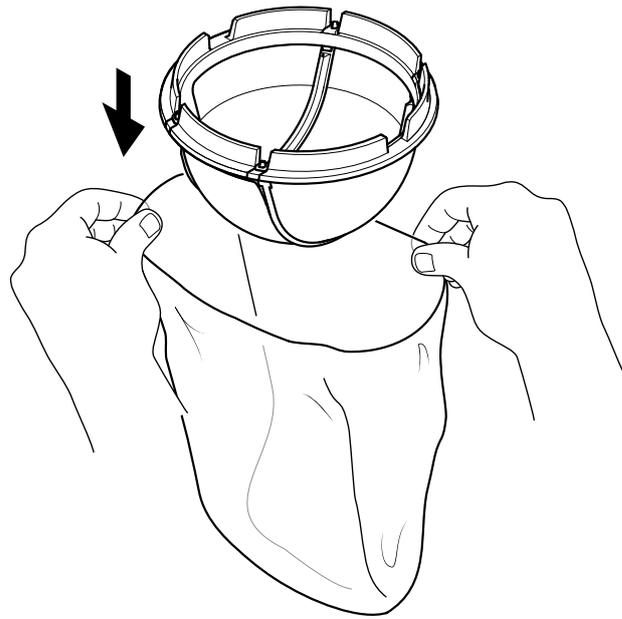


2. Mask the dome.

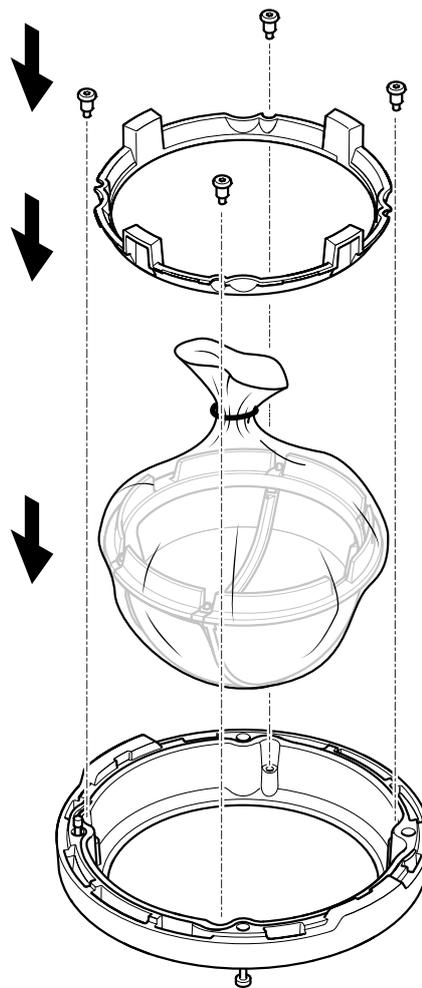


3. Reassemble the dome into the cover top.

**Note**

The dome gasket should not be included when painting.

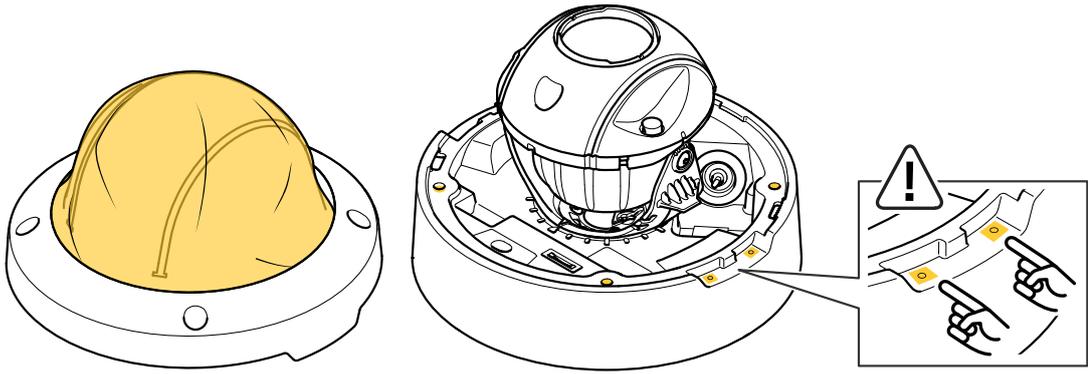


4. Mask the four screw holes. For AXIS Q3556-LVE and AXIS Q3558-LVE, mask the acoustic sensors.

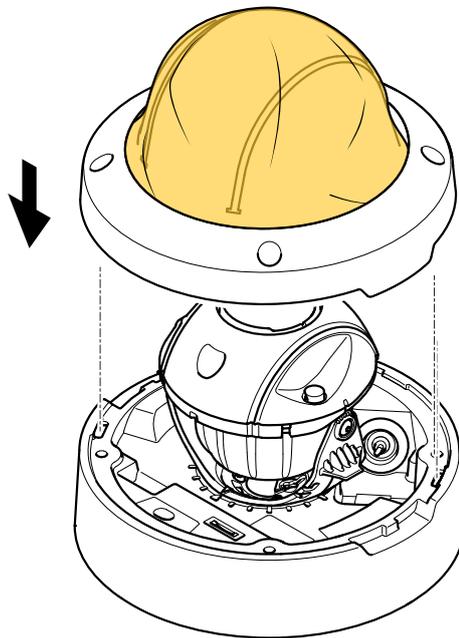

5. Remove the screws from the cover top. Put the cover top back on the camera.

**Note**

Make sure that the gap is not too big.

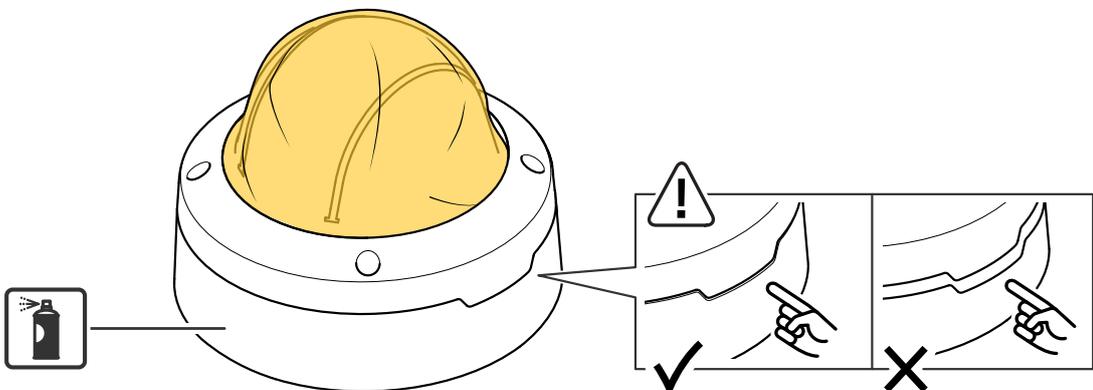

6. Apply a thin and even layer of spray paint according to the instructions of the paint manufacturer.
7. To get better coverage and clearer color, apply a second layer of spray paint.

8. When the paint is dry, remove the masking.

### **Reassembly**

1. Reassemble the cover top with the dome gasket.



T10216958

2025-05 (M1.6)

© 2025 Axis Communications AB